



(1)

## Evaluating the Potential for Rotation and Loss of Flight Helmets From Inertia and Impact Loads

(Reprint)



By

James E. Bruckart

and

Joseph L. Haley, Jr.

Aircrew Protection Division

19950509 110

March 1995

DTIC QUALITY ASSURANCE 6

Approved for public release; distribution unlimited.

United States Army Aeromedical Research Laboratory  
Fort Rucker, Alabama 36362-0577

## Notice

### Qualified requesters

Qualified requesters may obtain copies from the Defense Technical Information Center (DTIC), Cameron Station, Alexandria, Virginia 22314. Orders will be expedited if placed through the librarian or other person designated to request documents from DTIC.

### Change of address

Organizations receiving reports from the U.S. Army Aeromedical Research Laboratory on automatic mailing lists should confirm correct address when corresponding about laboratory reports.

### Disposition

Destroy this document when it is no longer needed. Do not return it to the originator.

### Disclaimer


The views, opinions, and/or findings contained in this report are those of the author(s) and should not be construed as an official Department of the Army position, policy, or decision, unless so designated by other official documentation. Citation of trade names in this report does not constitute an official Department of the Army endorsement or approval of the use of such commercial items.

Reviewed:




KEVIN T. MASON  
LTC, MC, MFS  
Director, Aircrew Protection  
Division

Released for publication:

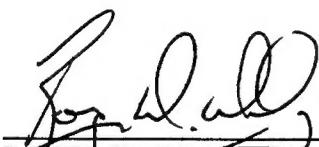  
ROGER W. WILEY, O.D., Ph.D.  
Chairman, Scientific  
Review Committee

Accession For	
NTIS	CRA&I
DTIC	TAB
Unannounced	
Justification _____	
By _____	
Distribution /	
Availability Codes	
Dist	Avail and / or Special
A-1	

  
DENNIS F. SHANAHAN  
Colonel, MC, MFS  
Commanding

## REPORT DOCUMENTATION PAGE

1a. REPORT SECURITY CLASSIFICATION Unclassified		1b. RESTRICTIVE MARKINGS	
2a. SECURITY CLASSIFICATION AUTHORITY		3. DISTRIBUTION / AVAILABILITY OF REPORT Approved for public release, distribution unlimited	
2b. DECLASSIFICATION / DOWNGRADING SCHEDULE			
4. PERFORMING ORGANIZATION REPORT NUMBER(S) USAARL Report No. 95-20		5. MONITORING ORGANIZATION REPORT NUMBER(S)	
6a. NAME OF PERFORMING ORGANIZATION U.S. Army Aeromedical Research Laboratory	6b. OFFICE SYMBOL (If applicable) MCMR-UAD	7a. NAME OF MONITORING ORGANIZATION U.S. Army Medical Research and Materiel Command	
6c. ADDRESS (City, State, and ZIP Code) P.O. Box 620577 Fort Rucker, AL 36362-0577		7b. ADDRESS (City, State, and ZIP Code) Fort Detrick Frederick, MD 21702-5012	
8a. NAME OF FUNDING / SPONSORING ORGANIZATION	8b. OFFICE SYMBOL (If applicable)	9. PROCUREMENT INSTRUMENT IDENTIFICATION NUMBER	
8c. ADDRESS (City, State, and ZIP Code)		10. SOURCE OF FUNDING NUMBERS	
13a. TYPE OF REPORT Final	13b. TIME COVERED FROM                    TO	14. DATE OF REPORT (Year, Month, Day) 1995 March	15. PAGE COUNT 5
16. SUPPLEMENTAL NOTATION <del>Reprint from Proceedings of the Thirty-First Annual Symposium, SAFE Association, November 8-10, 1993</del>			
17. COSATI CODES		18. SUBJECT TERMS (Continue on reverse if necessary and identify by block number) flight helmets, helicopter accidents, rotation, acceleration	
FIELD 23	GROUP 04		
20	11		
19. ABSTRACT (Continue on reverse if necessary and identify by block number) In severe helicopter accidents, flight helmets rotate or sometimes come off the head, triggering wearer injury. This study evaluates rotation potential for new flight helmets. Current and prototype flight helmets (SPH-4B and two versions of the HGU-56) were subjected to three tests. First, rotation was measured with up to a 50-pound upward pull at the rear edge of the helmet on a medium-size headform. Second, angular displacement was measured with a 30-pound force at the side of the helmet. Third, the helmet was placed on a Hybrid II headform and Hybrid III neck, then mounted on a pendulum test device. The freefalling pendulum was decelerated to produce 16 to 20 G peak acceleration at the neck. Angular displacement of the helmet versus time was measured with high-speed video.			
The upward pull tests produced 18 to 33 degrees of helmet rotation. Sideward loads produced 13 to 21 degrees of rotation. The pendulum test produced up to 45 degrees forward and up to 25 degrees rearward displacement.			
(Continued on next page)			
20. DISTRIBUTION / AVAILABILITY OF ABSTRACT <input checked="" type="checkbox"/> UNCLASSIFIED/UNLIMITED <input type="checkbox"/> SAME AS RPT. <input type="checkbox"/> DTIC USERS		21. ABSTRACT SECURITY CLASSIFICATION Unclassified	
22a. NAME OF RESPONSIBLE INDIVIDUAL Chief, Science Support Center		22b. TELEPHONE (Include Area Code) (334) 255-6907	22c. OFFICE SYMBOL MCMR-UAX-SI

19. Abstract (Continued):

The test series resulted in the selection of an improved HGU-56 design by the helmet developer. These tests may be improved by the use of more severe dynamic tests in the future to better reproduce severe impact conditions.

# Evaluating the Potential For Rotation and Loss of Flight Helmets From Inertia and Impact Loads

James E. Bruckart, M.D.

Joseph L. Haley, Jr

U.S. Army Aeromedical Research Laboratory  
Fort Rucker, AL 36362

**ABSTRACT** *In severe helicopter accidents, flight helmets rotate or sometimes come off the head, triggering wearer injury. This study evaluates rotation potential for new flight helmets. Current and prototype flight helmets (SPH-4B and two version of the HGU-56) were subjected to three tests. First, rotation was measured with up to a 50-pound upward pull at the rear edge of the helmet on a medium size headform. Second, angular displacement was measured with a 30 pound force at the side of the helmet. Third, the helmet was placed on a Hybrid II headform and Hybrid III neck, then mounted on a pendulum test device. The freefalling pendulum was decelerated to produce 16 to 20 G peak acceleration at the neck. Angular displacement of the helmet versus time was measured with high speed video.*

*The upward pull tests produced 18 to 33 degrees of helmet rotation. Sideward loads produced 13 to 21 degrees of rotation. The pendulum test produced up to 45 degrees forward and up to 25 degrees rearward displacement.*

*The test series resulted in the selection of an improved HGU-56 design by the helmet developer. These tests may be improved by the use of more severe dynamic tests in the future to better reproduce severe impact conditions.*

## INTRODUCTION

Although flight helmets were scorned by some early safety authorities<sup>1</sup>, Graeme Anderson reported in his 1919 aviation medicine text that of 58 training accidents in his experience, head protection saved student pilots from head injuries in 15.<sup>2</sup> Crowley studied survivable U.S. Army helicopter accidents from 1972-88 and found that the risk of fatal head injury was 6.3 times greater

in unhelmeted occupants compared with those wearing the SPH-4 ( $p<0.01$ ).<sup>3</sup>

The United States Army Aeromedical Research Laboratory (USAARL) evaluates aviation life support equipment (ALSE) retrieved from aircraft accidents. USAARL studies ALSE to correlate wearer injuries with the equipment performance. In 1984, Reading et al reported that 21 percent of the helmets in the USAARL database came off the wearer's head during the crash sequence. Chinstrap failure caused 63% of the helmet losses while failure or excessive stretching of the retention system accounted for the remainder.<sup>4</sup> In a later USAARL study by Vyrnwy-Jones et al, 18 of 60 flight helmets came off the wearer's head during the mishap. In this group of helmets, there were 11 chinstrap failures and 20 helmets with retention system damage. This study also found that the injuries were more severe for wearers that suffer excess rotation or loss of their flight helmet.<sup>5</sup>

These USAARL studies resulted in improvements to the retention system for Army flight helmets. The chinstrap of the original SPH-4 was upgraded in 1982 to include a dual-snap closure. The chinstrap was further improved when it was replaced with a stronger "yoke" chinstrap (440 lb vs 300 lb tensile strength and 1" vs 3" stretch) in the SPH-4B flight helmet. The strength of the chinstrap is tested by pulling the chinstrap with a prescribed load for 2 minutes and measuring the elongation. The chinstrap fails if there is excess elongation (typically  $> 1$  to 1.5 inches) or it separates. In addition, the sling suspension assembly in the SPH-4 has been replaced with a thermoplastic liner in the SPH-4B.<sup>6</sup>

Despite these enhancements and standard qualification tests, flight helmets are still subject

to rotation and loss in aircraft mishaps. For example, in a recent mishap all twelve occupants of an MH-60, including the lone survivor, lost their helmet when the aircraft struck water. This occurred despite the fact that four aircraft occupants were wearing the newer SPH-4B helmets.

The purpose of this study was to investigate new tests to detect the design features of existing and prototype flight helmets that prevent rotation or loss in an aircraft accident. This data was needed to guide selection of an improved retention system for the new Aircrew Integrated Helmet System (AIHS), now designated the Head Gear Unit number 56 for Personnel (HGU-56/P).

## MATERIALS AND METHODS

### FLIGHT HELMETS

The SPH-4B and two different versions of the new HGU-56/P were selected for testing. The size regular SPH-4B flight helmet includes a thermoplastic liner, enhanced yoke assembly, and chinstrap secured with D-rings. The two HGU-56/P flight helmets included thermoplastic liners and chinstraps secured with D-rings.

The standard HGU-56/P includes a stiff plastic plate in the back of the helmet which forces the head forward when straps behind the plate are tightened. This "nape plate" rests on the back of the head, above the occipital ridge of the skull. The earcups are fixed to the outer shell with velcro (figure 1).

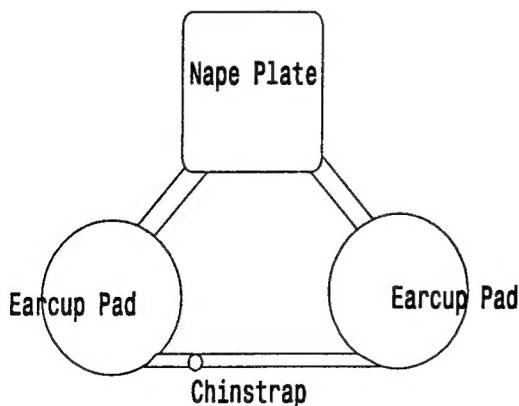


Figure 1. Nape plate and retention straps in original HGU-56/P flight helmet.

The revised HGU-56/P has a new retention system with a soft nape plate that form fits to the back of the skull, below the occipital ridge (figure 2). The velcro has been removed from the shell at the earcups and nylon straps run below the earcups to join the nape adjustment strap to the chinstrap. When the nape strap is tightened, the nape strap, side straps, and chinstrap form a ring around the base of the skull at the upper neck.

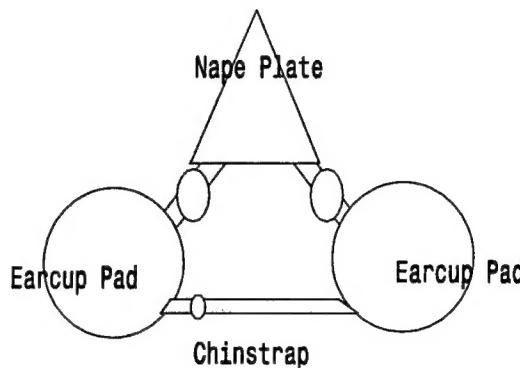


Figure 2. Nape strap and retention straps in improved HGU-56/P flight helmet.

### ROTATION TESTS

Forward rotation of the helmet (about the lateral y-axis) in response to inertia was simulated by pulling upward on the rear edge of the helmet shell. The test helmet was placed on a 50th percentile military pilot headform rigidly mounted. A spring scale was used to pull on a small hook placed at the rear edge of the helmet shell. The forward rotation of the helmet was measured in response to pulling forces up to 50 pounds.

Sideward displacement of the helmet (about the vertical z-axis) in response to impact on the side of the helmet was simulated by pulling on the side of the helmet shell. The test helmet was mounted on the same 50th percentile headform. A spring scale was used to push at the edge of the helmet shell along the visor cover. The angular displacement of the helmet was measured in response to forces up to 30 pounds.

Dynamic testing of retention was performed by mounting each helmet on a Hybrid II headform, attached to a Hybrid III neck simulator, and placed at the end of a 6-foot pendulum arm (figure 3). The pendulum was allowed to freefall

through a vertical distance of 3.32 feet and was stopped by a foam block. The pendulum deceleration produced a 16 to 20 G acceleration force measured at the base of the neck simulator. High speed (1000 f/s) video frames were reviewed to measure the rotation of the helmet for each 10 ms time increment.

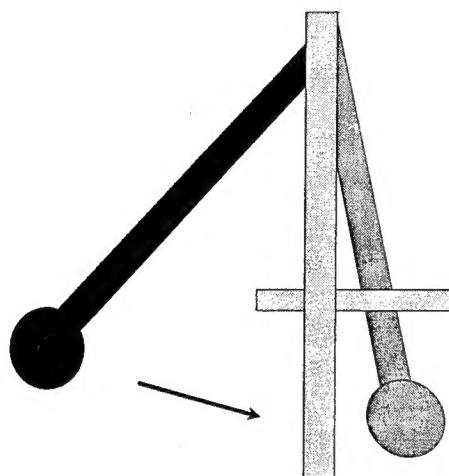


Figure 3. Schematic of pendulum test device.

## RESULTS

The forward rotation of the helmets in response to a 50 pound force applied to the rear edge of the helmet shell varied from 18 to 33 degrees as shown in figure 4. The 30 pound force applied to the side of the visor resulted in 13 to 21 degrees of sideward rotation as shown in figure 5. The dynamic test produced forward and rearward rotation of the helmet as the neck flexed forward and back. The dynamic response of each helmet, measured by the rotation of the helmet relative to the headform, is shown in figure 6.

## DISCUSSION

The most important factor in helmet retention is providing a chin strap and nape strap entity that will not stretch or tear in response to impact loads. USAARL has not seen a 440-pound tensile strength chin strap severed or separated in a survivable accident.

Compliant and stretchable materials are used to form the retention system and protective parts of most flight helmets. It is the stretching and compression of the retention system and internal foams that contributes to loss of helmets. For the

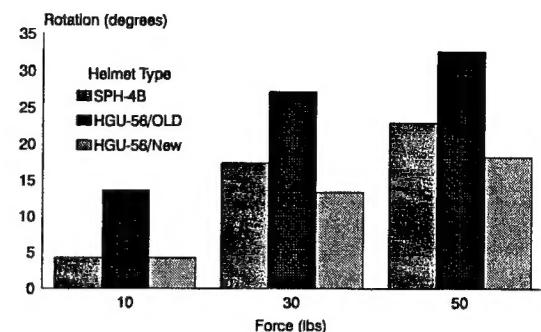


Figure 4. Forward rotation of helmets in response to force at rear edge of helmet.

helmet to dislodge from the head, there must be a large enough opening at the base of the helmet for the head to pass out of the helmet. The SPH-4B use a chin strap that is contiguous with material below the earcups and the nape strap to form a "ring" or "noose" around the neck. The circumference of this ring ultimately limits

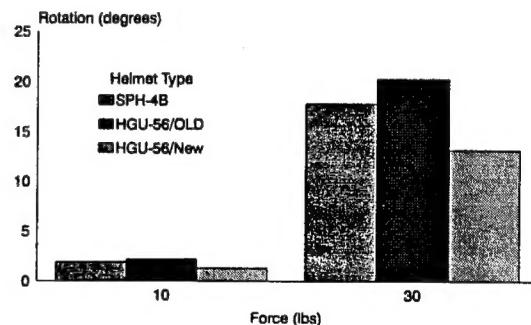


Figure 5. Sideward rotation of helmets in response to force at side of helmet visor.

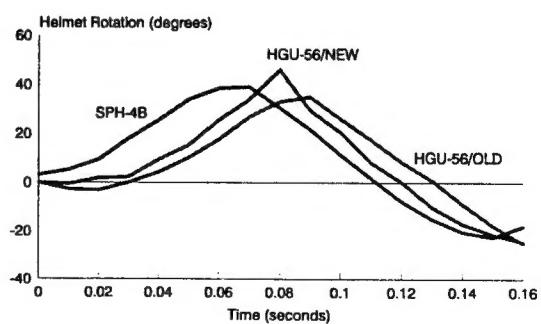


Figure 6. Forward and rearward rotation of the helmet on the head in response to dynamic impact simulation.

forward rotation and loss of the helmet. If the circumference of the "noose" is smaller than the circumference of the head, the helmet cannot rotate forward off the head. The original HGU-56/P configuration did not provide a separate nape strap or straps below the earcups. There was no ring of material around the neck to resist forward rotation. This resulted in the excess rotation and high potential for loss of this helmet. The new version of the HGU-56/P includes a separate nape strap that attaches to straps below each earcup. This forms a ring at the base of the neck and accounts for the superior performance of this design.

While the tests described in this paper assisted in evaluating the retention systems of these helmets, additional refinement of the test methods is required. We feel that greater loads should be placed on the back and sides of the helmet to better represent impacts in severe but survivable accidents. The torque applied in the horizontal plane to each helmet varies with the helmet diameter, but this variation simulates comparable torque applied to helmets with different diameters in actual crashes with tangential impacts.

### CONCLUSIONS

The static and dynamic tests of the retention systems in Army flight helmets assisted in selection of an improved retention system for the HGU-56/P. Further refinement of retention tests may be needed to better simulate inertia and impact forces in survivable accidents.

### REFERENCES

- (1) Robinson, D. H., The Dangerous Sky: A History of Aviation Medicine. University of Washington Press, Seattle, 1973.
- (2) Anderson, H. G., Medical and Survival Aspects of Aviation. Oxford University Press, London, p 192, 1919.
- (3) Crowley, John S., "Should Helicopter Frequent Flyers Wear Head Protection? A Study of Helmet Effectiveness." Journal of Occupational Medicine, Volume 33, 1991.
- (4) Reading, T. E., Haley, J. L., Jr., Sippo, A. C., Licina, J. R., and Schopper, A. W. SPH-4 US Army Flight Helmet Performance, 1972-1983. U.S. Army Aeromedical Research Laboratory. Fort Rucker, AL, USAARL Report 85-1, 1984.
- (5) Vyrnwy-Jones, Peter, Lanoue, Bernard, and Pritts, Douglas, SPH-4 U.S. Army Flight Helmet Performance 1983-1987. U.S. Army Aeromedical Research Laboratory. Fort Rucker, AL, USAARL Report No. 88-15, 1988.
- (6) Crowley, John S., Licina, Joseph R., and Bruckart, James E. "Flight Helmets: How They Work and Why You Should Wear One", Journal of Air Medical Transport, Vol 2, pp 19-26, 1992.

### BIOGRAPHICAL SKETCHES

Major James E. Bruckart is a Senior Flight Surgeon in the Aircrew Protection Division of the U.S. Army Aeromedical Research Laboratory. He completed Bachelor and Master of Science degrees in Biomedical Engineering at Tulane University prior to entering medical school. He is board certified in Family Practice and Aerospace Medicine.

Mr. Joseph L. Haley Jr. is a safety engineer for Science Applications International Corporation. He has accumulated 31 years experience in crashworthiness research including 8 years with Aviation Safety Engineering and Research in Phoenix, AZ and 23 years with the U.S. Army at Fort Rucker, AL. Mr. Haley is an original author of the Army's "Crash Survival Design Guide" and has authored over 30 publications on crashworthiness. He is the recipient of the Army's "Exceptional Civilian Service" award for his contributions to Army crash survival.

Initial distribution

**Commander, U.S. Army Natick Research,  
Development and Engineering Center  
ATTN: SATNC-MIL (Documents  
Librarian)  
Natick, MA 01760-5040**

**Chairman  
National Transportation Safety Board  
800 Independence Avenue, S.W.  
Washington, DC 20594**

**Commander  
10th Medical Laboratory  
ATTN: Audiologist  
APO New York 09180**

**Naval Air Development Center  
Technical Information Division  
Technical Support Detachment  
Warminster, PA 18974**

**Commanding Officer, Naval Medical  
Research and Development Command  
National Naval Medical Center  
Bethesda, MD 20814-5044**

**Deputy Director, Defense Research  
and Engineering  
ATTN: Military Assistant  
for Medical and Life Sciences  
Washington, DC 20301-3080**

**Commander, U.S. Army Research  
Institute of Environmental Medicine  
Natick, MA 01760**

**Library  
Naval Submarine Medical Research Lab  
Box 900, Naval Sub Base  
Groton, CT 06349-5900**

**Executive Director, U.S. Army Human  
Research and Engineering Directorate  
ATTN: Technical Library  
Aberdeen Proving Ground, MD 21005**

**Commander  
Man-Machine Integration System  
Code 602  
Naval Air Development Center  
Warminster, PA 18974**

**Commander  
Naval Air Development Center  
ATTN: Code 602-B  
Warminster, PA 18974**

**Commanding Officer  
Armstrong Laboratory  
Wright-Patterson  
Air Force Base, OH 45433-6573**

**Director  
Army Audiology and Speech Center  
Walter Reed Army Medical Center  
Washington, DC 20307-5001**

**Commander/Director  
U.S. Army Combat Surveillance  
and Target Acquisition Lab  
ATTN: SFAE-IEW-JS  
Fort Monmouth, NJ 07703-5305**

**Director  
Federal Aviation Administration  
FAA Technical Center  
Atlantic City, NJ 08405**

**Director  
Walter Reed Army Institute of Research  
Washington, DC 20307-5100**

**Commander, U.S. Army Test and Evaluation Command**  
**Directorate for Test and Evaluation**  
**ATTN: AMSTE-TA-M (Human Factors Group)**  
Aberdeen Proving Ground,  
MD 21005-5055

**Naval Air Systems Command**  
**Technical Air Library 950D**  
**Room 278, Jefferson Plaza II**  
**Department of the Navy**  
Washington, DC 20361

**Director**  
**U.S. Army Ballistic Research Laboratory**  
**ATTN: DRXBR-OD-ST Tech Reports**  
Aberdeen Proving Ground, MD 21005

**Commander**  
**U.S. Army Medical Research Institute of Chemical Defense**  
**ATTN: SGRD-UV-AO**  
Aberdeen Proving Ground,  
MD 21010-5425

**Commander**  
**USAMRMC**  
**ATTN: SGRD-RMS**  
Fort Detrick, Frederick, MD 21702-5012

**HQ DA (DASG-PSP-O)**  
5109 Leesburg Pike  
Falls Church, VA 22041-3258

**Harry Diamond Laboratories**  
**ATTN: Technical Information Branch**  
2800 Powder Mill Road  
Adelphi, MD 20783-1197

**U.S. Army Materiel Systems Analysis Agency**  
**ATTN: AMXSY-PA (Reports Processing)**  
Aberdeen Proving Ground  
MD 21005-5071

**U.S. Army Ordnance Center and School Library**  
Simpson Hall, Building 3071  
Aberdeen Proving Ground, MD 21005

**U.S. Army Environmental Hygiene Agency**  
**ATTN: HSHB-MO-A**  
Aberdeen Proving Ground, MD 21010

**Technical Library Chemical Research and Development Center**  
Aberdeen Proving Ground, MD 21010-5423

**Commander**  
**U.S. Army Medical Research Institute of Infectious Disease**  
**ATTN: SGRD-UIZ-C**  
Fort Detrick, Frederick, MD 21702

**Director, Biological Sciences Division**  
**Office of Naval Research**  
600 North Quincy Street  
Arlington, VA 22217

**Commandant**  
**U.S. Army Aviation Logistics School**  
**ATTN: ATSQ-TDN**  
Fort Eustis, VA 23604

**Headquarters (ATMD)**  
**U.S. Army Training and Doctrine Command**  
**ATTN: ATBO-M**  
Fort Monroe, VA 23651

**IAF Liaison Officer for Safety**  
USAF Safety Agency/SEFF  
9750 Avenue G, SE  
Kirtland Air Force Base  
NM 87117-5671

**Naval Aerospace Medical Institute Library**  
Building 1953, Code 03L  
Pensacola, FL 32508-5600

**Command Surgeon**  
HQ USCENTCOM (CCSG)  
U.S. Central Command  
MacDill Air Force Base, FL 33608

**Director**  
Directorate of Combat Developments  
ATTN: ATZQ-CD  
Building 515  
Fort Rucker, AL 36362

**U.S. Air Force Institute of Technology (AFIT/LDEE)**  
Building 640, Area B  
Wright-Patterson Air Force Base, OH 45433

**Henry L. Taylor**  
Director, Institute of Aviation  
University of Illinois-Willard Airport  
Savoy, IL 61874

**Chief, National Guard Bureau**  
ATTN: NGB-ARS  
Arlington Hall Station  
111 South George Mason Drive  
Arlington, VA 22204-1382

**AAMRL/HEX**  
Wright-Patterson  
Air Force Base, OH 45433

**Commander**  
U.S. Army Aviation and Troop Command  
ATTN: AMSAT-R-ES  
4300 Goodfellow Boulevard  
St. Louis, MO 63120-1798

**U.S. Army Aviation and Troop Command Library and Information Center Branch**  
ATTN: AMSAV-DIL  
4300 Goodfellow Boulevard  
St. Louis, MO 63120

**Federal Aviation Administration Civil Aeromedical Institute Library AAM-400A**  
P.O. Box 25082  
Oklahoma City, OK 73125

**Commander**  
U.S. Army Medical Department and School  
ATTN: Library  
Fort Sam Houston, TX 78234

**Commander**  
U.S. Army Institute of Surgical Research  
ATTN: SGDR-USM  
Fort Sam Houston, TX 78234-6200

**Air University Library (AUL/LSE)**  
Maxwell Air Force Base, AL 36112

**Product Manager**  
Aviation Life Support Equipment  
ATTN: SFAE-AV-LSE  
4300 Goodfellow Boulevard  
St. Louis, MO 63120-1798

**Commander and Director**  
**USAE Waterways Experiment Station**  
**ATTN: CEWES-IM-MI-R,**  
**CD Department**  
**3909 Halls Ferry Road**  
**Vicksburg, MS 39180-6199**

**Commanding Officer**  
**Naval Biodynamics Laboratory**  
**P.O. Box 24907**  
**New Orleans, LA 70189-0407**

**Assistant Commandant**  
**U.S. Army Field Artillery School**  
**ATTN: Morris Swott Technical Library**  
**Fort Sill, OK 73503-0312**

**Mr. Peter Seib**  
**Human Engineering Crew Station**  
**Box 266**  
**Westland Helicopters Limited**  
**Yeovil, Somerset BA20 2YB UK**

**U.S. Army Dugway Proving Ground**  
**Technical Library, Building 5330**  
**Dugway, UT 84022**

**U.S. Army Yuma Proving Ground**  
**Technical Library**  
**Yuma, AZ 85364**

**AFFTC Technical Library**  
**6510 TW/TSTL**  
**Edwards Air Force Base,**  
**CA 93523-5000**

**Commander**  
**Code 3431**  
**Naval Weapons Center**  
**China Lake, CA 93555**

**Aeromechanics Laboratory**  
**U.S. Army Research and Technical Labs**  
**Ames Research Center, M/S 215-1**  
**Moffett Field, CA 94035**

**Sixth U.S. Army**  
**ATTN: SMA**  
**Presidio of San Francisco, CA 94129**

**Commander**  
**U.S. Army Aeromedical Center**  
**Fort Rucker, AL 36362**

**Strughold Aeromedical Library**  
**Document Service Section**  
**2511 Kennedy Circle**  
**Brooks Air Force Base, TX 78235-5122**

**Dr. Diane Damos**  
**Department of Human Factors**  
**ISSM, USC**  
**Los Angeles, CA 90089-0021**

**U.S. Army White Sands**  
**Missile Range**  
**ATTN: STEWS-IM-ST**  
**White Sands Missile Range, NM 88002**

**Director, Airworthiness Qualification Test**  
**Directorate (ATTC)**  
**ATTN: STEAT-AQ-O-TR (Tech Lib)**  
**75 North Flightline Road**  
**Edwards Air Force Base, CA 93523-6100**

**Ms. Sandra G. Hart**  
**Ames Research Center**  
**MS 262-3**  
**Moffett Field, CA 94035**

**Commander**  
**USAMRMC**  
**ATTN: SGRD-UMZ**  
**Fort Detrick, Frederick, MD 21702-5009**

**Commander**  
**U.S. Army Health Services Command**  
**ATTN: HSOP-SO**  
**Fort Sam Houston, TX 78234-6000**

**U. S. Army Research Institute**  
**Aviation R&D Activity**  
**ATTN: PERI-IR**  
**Fort Rucker, AL 36362**

**Commander**  
**U.S. Army Safety Center**  
**Fort Rucker, AL 36362**

**U.S. Army Aircraft Development**  
**Test Activity**  
**ATTN: STEBG-MP-P**  
**Cairns Army Air Field**  
**Fort Rucker, AL 36362**

**Commander**  
**USAMRMC**  
**ATTN: SGRD-PLC (COL R. Gifford)**  
**Fort Detrick, Frederick, MD 21702**

**TRADOC Aviation LO**  
**Unit 21551, Box A-209-A**  
**APO AE 09777**

**Netherlands Army Liaison Office**  
**Building 602**  
**Fort Rucker, AL 36362**

**British Army Liaison Office**  
**Building 602**  
**Fort Rucker, AL 36362**

**Italian Army Liaison Office**  
**Building 602**  
**Fort Rucker, AL 36362**

**Directorate of Training Development**  
**Building 502**  
**Fort Rucker, AL 36362**

**Chief**  
**USAHEL/USAAVNC Field Office**  
**P. O. Box 716**  
**Fort Rucker, AL 36362-5349**

**Commander, U.S. Army Aviation Center**  
**and Fort Rucker**  
**ATTN: ATZQ-CG**  
**Fort Rucker, AL 36362**

**Dr. Sehchang Hah**  
**Dept. of Behavior Sciences and**  
**Leadership, Building 601, Room 281**  
**U. S. Military Academy**  
**West Point, NY 10996-1784**

**Canadian Army Liaison Office**  
**Building 602**  
**Fort Rucker, AL 36362**

**German Army Liaison Office**  
**Building 602**  
**Fort Rucker, AL 36362**

**French Army Liaison Office**  
**USAAVNC (Building 602)**  
**Fort Rucker, AL 36362-5021**

**Australian Army Liaison Office**  
**Building 602**  
**Fort Rucker, AL 36362**

**Dr. Garrison Rapmund**  
**6 Burning Tree Court**  
**Bethesda, MD 20817**

**Commandant, Royal Air Force**  
**Institute of Aviation Medicine**  
**Farnborough, Hampshire GU14 6SZ UK**

Defense Technical Information  
Cameron Station, Building 5  
Alexandria, VA 22304-6145

Commander, U.S. Army Foreign Science  
and Technology Center  
AIFRTA (Davis)  
220 7th Street, NE  
Charlottesville, VA 22901-5396

Commander  
Applied Technology Laboratory  
USARTL-ATCOM  
ATTN: Library, Building 401  
Fort Eustis, VA 23604

Commander, U.S. Air Force  
Development Test Center  
101 West D Avenue, Suite 117  
Eglin Air Force Base, FL 32542-5495

Aviation Medicine Clinic  
TMC #22, SAAF  
Fort Bragg, NC 28305

Dr. H. Dix Christensen  
Bio-Medical Science Building, Room 753  
Post Office Box 26901  
Oklahoma City, OK 73190

Commander, U.S. Army Missile  
Command  
Redstone Scientific Information Center  
ATTN: AMSMI-RD-CS-R  
/ILL Documents  
Redstone Arsenal, AL 35898

Aerospace Medicine Team  
HQ ACC/SGST3  
162 Dodd Boulevard, Suite 100  
Langley Air Force Base,  
VA 23665-1995

U.S. Army Research and Technology  
Laboratories (AVSCOM)  
Propulsion Laboratory MS 302-2  
NASA Lewis Research Center  
Cleveland, OH 44135

Commander  
USAMRMC  
ATTN: SGRD-ZC (COL John F. Glenn)  
Fort Detrick, Frederick, MD 21702-5012

Dr. Eugene S. Channing  
166 Baughman's Lane  
Frederick, MD 21702-4083

U.S. Army Medical Department  
and School  
USAMRDALC Liaison  
ATTN: HSMC-FR  
Fort Sam Houston, TX 78234

NVESD  
AMSEL-RD-NV-ASID-PST  
(Attn: Trang Bui)  
10221 Burbeck Road  
Fort Belvoir, VA 22060-5806

CA Av Med  
HQ DAAC  
Middle Wallop  
Stockbridge, Hants S020 8DY UK

Dr. Christine Schlichting  
Behavioral Sciences Department  
Box 900, NAVUBASE NLON  
Groton, CT 06349-5900

Commander  
Aviation Applied Technology Directorate  
ATTN: AMSAT-R-TV  
Fort Eustis, VA 23604-5577

**COL Yehezkel G. Caine, MD**  
Surgeon General, Israel Air Force  
Aeromedical Center Library  
P. O. Box 02166 I.D.F.  
Israel

**HQ ACC/DOHP**  
205 Dodd Boulevard, Suite 101  
Langley Air Force Base,  
VA 23665-2789

**41st Rescue Squadron**  
41st RQS/SG  
940 Range Road  
Patrick Air Force Base,  
FL 32925-5001

**48th Rescue Squadron**  
48th RQS/SG  
801 Dezonia Road  
Holloman Air Force Base,  
NM 88330-7715

**HQ, AFOMA**  
ATTN: SGPA (Aerospace Medicine)  
Bolling Air Force Base,  
Washington, DC 20332-6128

**ARNG Readiness Center**  
ATTN: NGB-AVN-OP  
Arlington Hall Station  
111 South George Mason Drive  
Arlington, VA 22204-1382

**35th Fighter Wing**  
35th FW/SG  
PSC 1013  
APO AE 09725-2055

**66th Rescue Squadron**  
66th RQS/SG  
4345 Tyndall Avenue  
Nellis Air Force Base, NV 89191-6076

**71st Rescue Squadron**  
71st RQS/SG  
1139 Redstone Road  
Patrick Air Force Base,  
FL 32925-5000

**Director**  
Aviation Research, Development  
and Engineering Center  
ATTN: AMSAT-R-Z  
4300 Goodfellow Boulevard  
St. Louis, MO 63120-1798

**Commander**  
USAMRMC  
ATTN: SGRD-ZB (COL C. Fred Tyner)  
Fort Detrick, Frederick, MD 21702-5012

**Commandant**  
U.S. Army Command and General Staff  
College  
ATTN: ATZL-SWS-L  
Fort Leavenworth, KS 66027-6900

**Director**  
Army Personnel Research Establishment  
Farnborough, Hants GU14 6SZ UK

**Dr. A. Kornfield**  
895 Head Street  
San Francisco, CA 94132-2813

**Mr. George T. Singley, III**  
Deputy Assistant Secretary of the Army  
for Research and Technology  
and Chief Scientist  
ATTN: Room 3E374  
103 Army Pentagon  
Washington, DC 20310-0103

The Honorable Gilbert F. Decker  
Assistant Secretary of the Army  
for Research, Development,  
and Acquisition

ATTN: Room 2E672  
103 Army Pentagon  
Washington, DC 20310-0103

Dr. Craig Dorman  
Office of the Deputy Director,  
Defense Research and Engineering  
ATTN: Room 3D129LM  
103 Army Pentagon  
Washington, DC 20310-0103

HQ, AFOMA  
ATTN; SGPA (Aerospace Medicine)  
Bolling Air Force Base,  
Washington, DC 20332-6188

Cdr, PERSCOM  
ATTN: TAPC-PLA  
200 Stovall Street, Rm 3N25  
Alexandria, VA 22332-0413